



| Report No. | : | xxx | Re - Inspection |
|-------------------------|---|---|-----------------|
| Client Name | : | xxx | |
| Order / P.O / P.I No. | : | KS17-501977 | |
| Product Description | : | Bluetooth speaker | |
| Product Item / Part No. | : | MA-825-B | |
| Product Quantity | : | 6000 Pcs | |
| Supplier Name | : | xxx | |
| Inspection Date | : | 2018-01-22 | |
| Inspection Location | : | Huangjiang Town, Dongguan City, Guangdong Province, China | a |

WORKMANSHIP INSPECTION PLAN AND DEFECTS QTY

| Inspection Standard: ANSI/ASQC Z 1.4-2003 | | | AQ | L S | tandard | Allow Defects QTY | Actual Defects QTY |
|---|---|---------------|----------|-----|---------|-------------------|--------------------|
| Sampling Plan | : | Single Normal | Critical | : | 0 | 0 | 0 |
| Inspection Level | : | GII | Major | : | 0.65 | 3 | 0 |
| Total Sample Size | a | 200 | Minor | : | 1.0 | 5 | 4 |

INSPECTION DETAILS RESULT

| 1) | QUANTITY | <u>:</u> | Conform |
|----|----------------------------|----------|--|
| 2) | WORKMANSHIP | : | Conform |
| 3) | ARTWORKS | : | Conform |
| 4) | PACKAGING | : | Conform |
| 5) | SHIPPING MARK | : | Conform |
| 6) | TESTING / DATA MEASUREMENT | : | Not Conform, Refer to Special Attentions:1~2 |

INSPECTION OVERALL CONCLUSION : ACCEPTED PENDING X FAILED

| | SPECIAL ATTENTION | | | | | |
|---|-------------------|--|--|--|--|--|
| | 1 | The factory not provides equipment for the Bluetooth frequency test. | | | | |
| ı | 2 | Actual measure data, Pls check page 7. | | | | |

| Name(s) of Insp | ector(s) | | Name of Reviewe | Name of Reviewer | | | | |
|-----------------|----------|-----------|-----------------|------------------|-----------|--|--|--|
| 2018-01-22 | Tom Tang | | 2018-01-23 | Chuck Shi | Chuck shi | | | |
| Date | Name | Signature | Date | Name | Signature | | | |

The inspection report reflects our findings at the time and place of inspection. This report does not relieve the seller/manufacturer of their contractual liabilities or prejudice from the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter.

| HONOR INSPECTION |
|---------------------------|
| INTERNATIONAL LTD. NINGBO |
| REPRESENTATIVE OFFICE. |

Page 1 of 25





| Special Attention Refer Photos | | | | | |
|--------------------------------|--|--|--|--|--|
| Nil | | | | | |
| | | | | | |
| | | | | | |







RANDOM SAMPLING PLAN FOR EACH ITEM

| 1) | QUANTITY | | | | | | |
|-------|-----------------|---------------|-----------------|--------------------|---------------|----------|------------|
| Resul | t: Conform | | | | | | |
| | | Ondon | Da alaa d | Matazalaad | Not the labor | Samp | ling Size |
| No. | Item / Part No. | Order | Packed | Not packed | Not finished | Packed | Not packed |
| | | Quantity | Quantity | Quantity | Quantity | Quantity | QTY |
| 1 | MA-825-B | 6000 | 6000 | 0 | 0 | 200 | 0 |
| | Total | 6000 | 6000 | 0 | 0 | 200 | 0 |
| | | Data Red cold | or marked was/w | ere found out of s | pecification. | | |








| The insp | pection details were found as follows: | | | |
|-----------|--|----------|----------|-------|
| 2) | WORKMANSHIP | | | |
| Result: | Conform | | | |
| Defects I | Description | Critical | Major | Minor |
| Item No.: | : MA-825-B | De | fects QT | Υ |
| Scratch | mark on product (Pls. see Pic.1) | 0 | 0 | 1 |
| Foreign | (Pls. see Pic.2~3) | 0 | 0 | 2 |
| Scratch | mark on gift box(Pls. see Pic.4) | 0 | 0 | 1 |
| | Individual Total Found: | 0 | 0 | 4 |
| | | | -" | |
| | Total Defects Found: | 0 | 0 | 4 |
| | AQL Standard Allowed: | 0 | 3 | 5 |



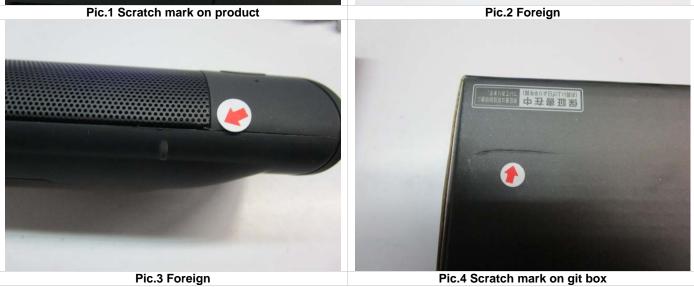





| 3) | ARTWORKS | |
|---------|---|---------|
| Result: | Conform | |
| | Markings/ logos/ labels on the gift box | Conform |
| | Markings/ logos/ labels on the product | Conform |
| | Color of product | Conform |
| | Instruction Manual | Conform |
| | Barcode/ QR code | Conform |
| | Others- | N/A |

| Barcode Readability Check | | | | (| 5 5 | Samples |) | Conforn | n |
|---------------------------|--|---------------|------|-------|-----|---------|---------|---------|--------|
| Item No | Specification | Actual | Item | No No | | Spec | ificati | on | Actual |
| MA-825-B | 4589917677148 | 4589917677148 | | | | | | | |
| | Data Red color marked was/were found out of specification. | | | | | | | | |

| 4) PACKAGI | PACKAGING | | | | | | |
|-----------------|--|-----------------------|-----------------|--|--|--|--|
| Result: Conform | | | | | | | |
| Item No | Accessories | Unit Packing | Unit per Carton | | | | |
| MA-825-B | 1pc USB Charging Cable, Audio | Each pc was packed in | 30 Pcs | | | | |
| | Cable, Holder | gift box into carton. | | | | | |
| | Pata Red color marked was/were found out of specification. | | | | | | |

| Dimension of cart | on (L×W×H cm) | 164 | 5 | Samples) Confo | rm | | | |
|--|----------------|------------|---------|-----------------|--------|--|--|--|
| Item No | Specification | Actual | Item No | Specification | Actual | | | |
| MA-825-B | 44.5x37.6x50.4 | 45x38x50.5 | | | | | | |
| Data Red color marked was/vere found out of specification. | | | | | | | | |

| Weight of carton | (Kgs) | | (5 | Samples) | Confor | n | |
|------------------|---------------|---------------------|----------------------|--------------------------------|--------|--------|--|
| Item No | Specification | Actual | Item No | em No Specifi <mark>c</mark> a | | Actual | |
| MA-825-B | N/A | 16.51 | | | | | |
| | Data I | Red color marked wa | as/were found out of | specification. | | | |

5) SHIPPING MARK

Result: Conform






Page 5 of 25





| 6) | TESTING / DATA MEASUREMENT | | | | | |
|---------|-------------------------------------|---|-----|---------|---|---------|
| Result: | Conform | | | | | |
| | Basic function check | (| 200 | Samples |) | Conform |
| | Charging check | (| 200 | Samples |) | Conform |
| | Basic function check | (| 200 | Samples |) | Conform |
| | Charging check | (| 200 | Samples |) | Conform |
| | Dimension check (length x width) | (| 5 | Samples |) | Conform |
| | Product inside check | (| 1 | Samples |) | Conform |
| | Net Weight check | (| 5 | Samples |) | Conform |
| | Rubbing test | (| 5 | Samples |) | Conform |
| | Drop test on outer carton (H=61 cm) | (| 1 | Carton |) | Conform |

| | Dimension che | Dimension check | | | Samples) Conform | | | | |
|--------------------|--------------------|---|---------------|---------------|-------------------|---------------|---------------|--|--|
| Item No.: MA-825-B | | | | | | | | | |
| No. | Description | Spec | No.1 | No.2 | No.3 | No.4 | No.5 | | |
| 1 | length x width x H | 220x45x75mm | 220x41.6x72.1 | 220x41.6x72.1 | 220x41.6x72.0 | 220x41.6x72.1 | 220x41.6x72.1 | | |
| 2 | Net weight check | 335g | 331g | 333g | 331g | 332g | 331g | | |
| 3 | USB cable length | N/A | 81.7cm | 82.1cm | 81.7cm | 82cm | 81.8cm | | |
| 4 | Auto cable length | N/A | 122.8cm | 123cm | 122.9cm | 122.7cm | 123cm | | |
| | | Pata Red color marked was/were found out of specification | | | | | | | |

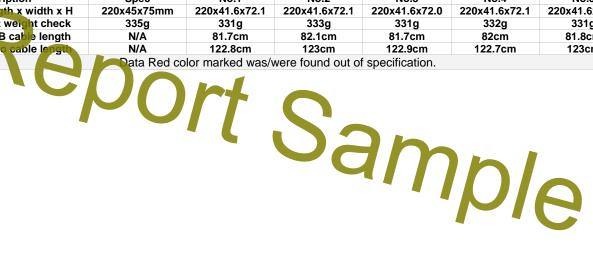











Packed goods pile

Packed goods pile



Export carton



Top view of export cartor



Shipping mark













Detail of gift box

Detail of gift box























Product-all parts






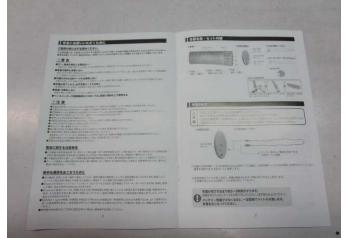

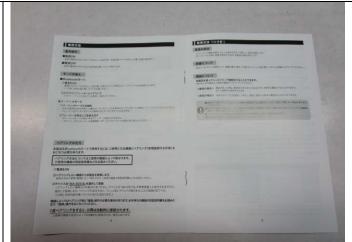

Instruction manual

Instruction manual

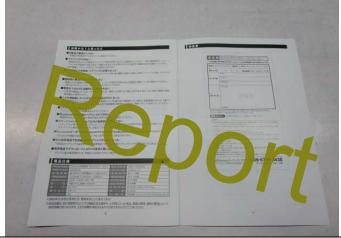



株式会社ピーナッツ・クラブ お客様サービスセンター 〒577-0034 大阪府東大阪市御厨南2-1-33 06-6789-3438 月~金(祝日のそく)10~16時



Instruction manual





































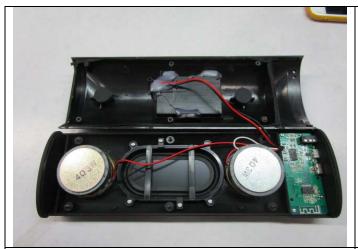

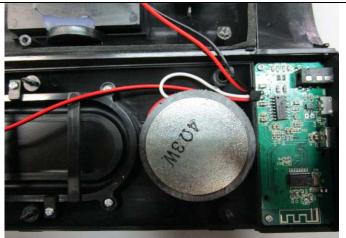

Internal check

Internal check

N/A



Internal check

Sa





Dimension check



Dimension check












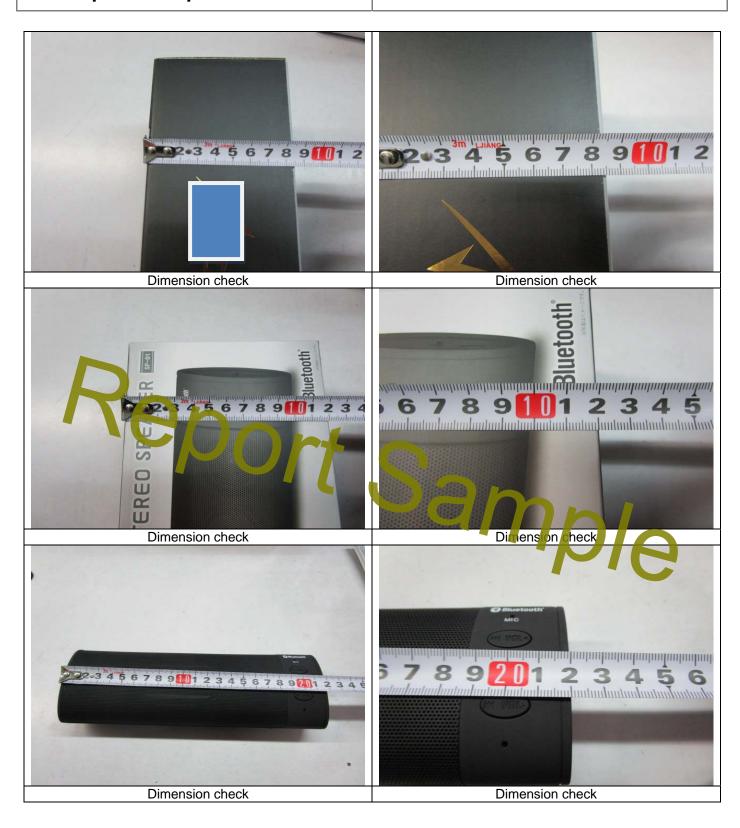









Dimension check

Dimension check





Weight check

Weight check





Weight check

Weight check







Rubbing test

Rubbing test







Function check(Use phone)

Function check(Use phone)









Function check(Use phone)

Call function check

Function check(Use Audio cable)



Charing check 商品 4589917677148 来自 日本

Charing check

Barcode scan









-This is end of Report-

Report Sample